

# SNAP ACTION SWITCHES

## APPLICATION SPECIFIC SWITCHES

### REVERSING SWITCH Three Phase

Order #101703A-3


Handle: Oval

Jumpers not supplied

Break-before-make contacts



DECKS	CONTACTS	POS.		
		REV	OFF	FOR
1	1-2 1-3	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
2	6-4 6-5	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
3	7-8 7-9	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>

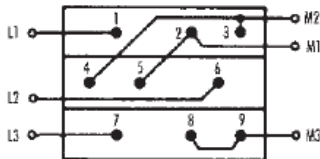

### WYE DELTA Changeover Switch

Order #101603A-2

For motor speed control


Handle: Oval

Jumpers not supplied

Break-before-make contacts



DECKS	CONTACTS	POS.	
		Y	Δ
1	1-2 1-3	<input checked="" type="checkbox"/>	<input type="checkbox"/>
2	6-4 6-5	<input type="checkbox"/>	<input checked="" type="checkbox"/>
3	7-8 7-9	<input type="checkbox"/>	<input checked="" type="checkbox"/>

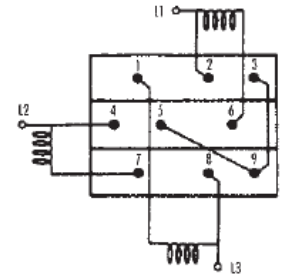

### SHIP-TO-SHORE Changeover Switch

Order #101602A-2A


Handle: Oval

Jumpers not supplied

Break-before-make contacts



DECKS	CONTACTS	POS.	
		SHIP	SHORE
1	1-2 1-3	<input checked="" type="checkbox"/>	<input type="checkbox"/>
2	6-4 6-5	<input type="checkbox"/>	<input checked="" type="checkbox"/>

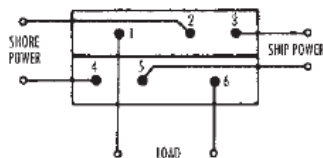

### VOLTMETER Transfer Switch

Order #10104C

3-phase, phase-to-phase


Handle: Round, Knurled

Nameplates and jumpers are supplied

Break-before-make contacts



DECKS	CONTACTS	POS.		
		OFF	1-2	2-3
1 & 2	1-2 1-3 4-3	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
3 & 4	5-6 5-7 4-8	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>

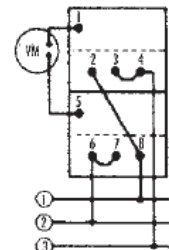

# AMMETER Transfer Switch

Order #10110C

3-phase, 3 current transformers

Handle: Round, Knurled


Nameplates and jumpers are supplied

Make-before-break contacts



DECKS	CONTACTS	POS.				
		OFF	*	1	2	3
1 & 2	1-2 3-4	X	X	X	X	X
3 & 4	5-6 7-8 9	X	X	X	X	X

\*Denotes make-before-break

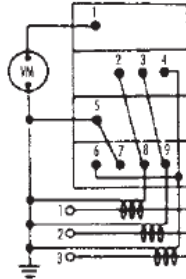

# AMMETER-VOLTMETER Transfer Switch

Order #10115C


3-phase, phase-to-phase

3 current transformers

Handle: Round, Knurled

Nameplates and jumpers are supplied

Make-before-break (shorting) contacts

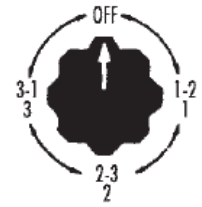

DECKS	CONTACTS	POS.				
		OFF	*	1	2	3
1 & 2	1-2 3-4	X	X	X	X	X
3 & 4	5-6 7-8	X	X	X	X	X
5 & 6	9-10 11-12	X	X	X	X	X
7 & 8	13-14 15-16 17	X	X	X	X	X

